

Date	Device Type	Rationale
01-Sep	Passenger Hydro	The low pressure switch does not work electrically.
02-Sep	Passenger Hydro	Car Door restrictor not working
08-Sep	Passenger Traction	The hoist rope diameter is less than 8mm and there is substantial rouging present. This exceeds rejection criteria.
09-Sep	Passenger Hydro	Car Door restrictor not working
12-Sep	Passenger Traction	Safeties are tied down with a rope and do not function
13-Sep	LPPD Vert Enclosed	The unit with a load (550lbs) less than rated (800lbs) is breaking traction.
13-Sep	Passenger Hydro	Escape hatch plug is broken and Car Door Restrictor is not working
19-Sep	Passenger Hydro	Low pressure switch not working
19-Sep	Passenger Traction	Failure of the Car Door Restrictor
19-Sep	Passenger Traction	Failure of the Car Door Restrictor
20-Sep	Escalator	skirt gaps exceeding maximum gap and the skirt/comb intersection is larger than permitted / The brake torque is well below data plate.
20-Sep	Escalator	The skirt gap exceeds maximum allowed / the measured brake torque is half specified / Right skirt panel has significant damage (exposed area)
20-Sep	Escalator	Broken Handrail Drive Shaft Bearing
20-Sep	Escalator	The horizontal comb impact switches are not activating at upper or lower landing.
20-Sep	Escalator	The combplate assembly is seized and no lateral movement and won't trip the switch.
20-Sep	Passenger Traction	Whisperflex emergency plug not attached to whisperflex, will never activate in an emergency situation
21-Sep	Escalator	The measured brake torque was 62 lbs and brake data tag minimum torque is 81 lbs.
21-Sep	Escalator	The horizontal combplate switches are not activating when combplat impacted.
21-Sep	Passenger Traction	Improper alignment of Hoist Ropes.
21-Sep	Passenger Hydro	Emergency Signaling Devices do not operate without without 120v a/c power. Battery back-up not working
21-Sep	LPPD Vert Enclosed	Unexplained oil loss. Unit Cavitating. Oil inpit/cylinder hole. Corrosion present at cylinder
22-Sep	Escalator	The horizontal comb switches on top and bottom landings are not activating when combs are moved.
22-Sep	Roped Hydro	Car Door restrictor not working
22-Sep	Traction MRL	Car Door restrictor not working
23-Sep	Escalator	Step track doesn't meet OEM Specifications
23-Sep	Freight Traction	Spirator cable is broken and the door does not close by itself
23-Sep	LULA	Nonoperating emergency signaling devices
26-Sep	LPPD Vert Enclosed	Emergency Stop Button does not stop Lift with Stop Button depressed. Emergency Alarm does not function. Wall Anchors are coming loose and Rail Brackets are lifting off Rail Wall. Back of Counterweight is within 1/16" from striking Block Wall Anchor.
26-Sep	Passenger Traction	Car door restrictor- non operating.
26-Sep	Passenger Hydro	Car door restrictor- non operating.
27-Sep	Passenger Hydro	Emergency signaling devices do not work in the absence of 120vac power. Battery back-up(s) not working, Phone non-functioning in any state.
27-Sep	Passenger Hydro	Broken Hall Door Closer found on Floor 2 Hall Door.
29-Sep	LPPD Vert Enclosed	Slack Rope Switch is not functioning to stop pump motor from turning after Safety Drop Test.
29-Sep	Passenger Traction	Emergency Phone and Alarmnot working
29-Sep	Passenger Traction	Seal missing on Overspeed Governor.