Date	Device Type	Rationale
CD-5597	Successor .	Anti-revental not functioning
CD-5597	Successor .	District switches, were not alread correctly and the day to skirt dearlease; used to be restified
G2-5597	Escalator .	Broker chain constition is shied and will not look unit in place.
G2-5597	19200 MML	Strengency Phone and alarm bell not functioning
G9-556/	Facoringer Traction	The elactoment buffer/bumper was completely detached from the buffer cond and lying on its cide.
	Faconner (mydra	Emergency Phone and alarm bell not functioning
	faceneroway	The Car Door Restrictor is not functioning as required
	Faccenger Hydra	The Car Door Restrictor is not functioning acrequired
C2-55H	Escalator .	The stee chain has stretched beyond tolerance
C2-5597	toolater	Multiple brokes clea treads
	Facement MKL	the rectabor is not functioning and the gradies is leaking onto the machine brokes.
	Bucalatar	The skirt switchs at the bottom landing are mosting the plunger in the skirt panel.
	Pagengerotydra	The Car Door Restrictor is not functioning as required
	BF Vertibed	Fadure of the PS Stop Switch
	Bucalatar	Bokes Step breads
	Stadios MRL	The counterweight governor rope is damaged. Approximately 20' section showing damage.
	Facement Toction	The Car Door Restrictor is not functioning as required
	Facement Toction	The Car Door Restrictor is not functioning as required
	Faconger Toction	The Car Door Restrictor is not functioning acrequired
	SF Vertiled	The horz size had major deformation causing the cibile to sub on the cibir; of the ditur divisor and was wearing
		through the honz sope and causing breaks, emergency alone beth fight not functioning as well.
20.554		The Car Door Restrictor is not functioning as required
	BF Platform	Extreme Binding when carrindown towel. Car shakes
	Foogeneer Toutlan	Structor that down due to expreed CROSK served to building paner. Time to complete work has passed thirday due date.
	ST Road today Tradion MRL	The safeties did not engage during the drop test. Found serious damper to a whole size law.
	Facenser Tochor	trioriscer speriotion of Rose Stroper
	EF Road Hubbs Facement Toction	The low pressure switch does not mechanisativ change state.
20:500	Pagender Tochor	The rape proper and and accessibly handware is all locus and recover chans. Counterwealth is also hitting the coning buffer when arriving at the tap landing.
	BY SEAL PER	Falur of the downful creative edge comp/las.
	87 Vert Sed	PE clas certify not working
	Facender mydra	PE stor certify not working. Tailure of the car door rectricor and the Tailure of the Car Door Gate Switch
	BF Vertilled	Faiture of the car door rectrictor and the Faiture of the Car Door date twitch. Entergency lowering device is non-operational does not engage with the year box.
	BF Vertiland	Metry switch would not activate when cafeting were assisted.
	BE NOT BUT	Madefratory made to the before reference with and Pourtor's to the relocked excitors
	Succession .	The equilitor succests the careb state teeth above the creat readcings medied.
	Bookston.	The equilitor succests the controllate teeth above the clear treadcreat medical.
	Durrigwater/	ManZisser, had not been changed as required by a ZES in service inspection. Riser(i) are no longer usuable.
	BE NOT BUT	Danased beformed sovemor cable
	EF Drum Tradium	Safter, did not engage
	Borrane .	The top left comb impact switch does not mechanically trip horsonially.
		The most recent \$ 3 ft of the first contract of other to recent or the design of the contract
95,650	BY Vest End	Emergency lowering device not working